

Lashing point Load Ring weldable > LRBS-FIX <



Safety instructions

This safety instruction/declaration has to be kept on file for the whole lifetime of the product.

Translation of the original safety instruction



RUD Ketten
Rieger & Dietz GmbH u. Co. KG
73428 Aalen
Tel. +49 7361 504-1370
Fax +49 7361 504-1460
slings@rud.com
www.rud.com

RUD-Art.-Nr.: 7901036-EN / 01.020



Lashing point
Load Ring weldable
LRBS-FIX

Herstellererklärung

Hiermit erklären wir (unterstützt durch die Zertifizierung nach ISO 9001), dass die nachfolgend bezeichnete Ausrüstung aufgrund ihrer Konzipierung und Bauart, sowie der von uns in Verkehr gebrachten Ausführung, den einschlägigen grundlegenden Sicherheits- und Gesundheitsanforderungen der Europäischen Union entspricht. Bei einer nicht mit uns abgestimmten Änderung der Ausrüstung verliert diese Erklärung ihre Gültigkeit. Weiterhin verliert diese Erklärung ihre Gültigkeit, wenn die Ausrüstung nicht entsprechend den in der Betriebsanleitung aufgeführten bestimmungsmäßigen Fällen eingesetzt wird.

Hinweis: Beim Zurrpunkt angewendete harmonisierte Normen DIN EN ISO 12100 T1 und T2 sowie in Anlehnung an EN 1677.

Bezeichnung der Ausrüstung:
Zurrpunkt

Type: Load Ring Welding - LRBS-FIX

Herstellerzeichen:

Declaration of the manufacturer

We hereby declare (supported by ISO 9001 certification), that the following described equipment based on the concept and design as well as the by us manufactured type corresponds to the current valid Health- and Safety Requirements of the EU. This declarations becomes invalid in case of any modifications not agreed upon with us. Furthermore this declaration becomes invalid if the equipment is not used according to this prescription.

Hint: Utilized harmonized standards for this Lashing Point DIN EN 12 100 T1 and T2 as well as EN 1677..

Designation of the equipment:
Lashing point

Type: Load Ring Welding - LRBS-FIX

Manufacturer's sign:



Before initial usage of the RUD-LRBS-FIX, please read carefully the safety instructions. Make sure that you have understood all subjected matters. Non-observance can lead to serious personal injuries and material damage and eliminates warranty.

1 Safety instructions



ATTENTION

Wrong positioned or damaged weld-on lashing points as well as improper use can lead to injuries of persons and damage at property, when load falls down. Please check all lashing points carefully before every usage.

- The lashing points must not protrude in rest position over the loading platform level.
- RUD-lashing points LRBS-FIX must only be used by instructed and competent persons considering BGR 500 (DGUV 100-500), and outside Germany noticing the country specific statutory regulations.

2 Intended use of the LRBS-FIX

RUD-lashing points LRBS-FIX must only be used to attach lashing means.

In general, lashing points must not be used for lifting! RUD-lashing points must only be used in the hereby specified case of operation.

3 Assembly- and instruction manual

3.1 General information

- Capability of temperature usage:

As of 07/2019: RUD-Lashing points LRBS-FIX are suitable for the temperature range from -40°C up to 400°C.

Up to 07/2019: RUD-Lashing points LRBS-FIX are suitable for the temperature range from -20°C up to 400°C.

For the use within the following temperature range, the WLL must be reduced by the following factors:

| | |
|---------------------------|--------------|
| -40°C / -20°C up to 200°C | no reduction |
| 200°C up to 300°C: | by -10 % and |
| 300°C up to 400°C: | by -25 % |

Temperatures exceeding 400°C are prohibited

In the unloaded state, LRBS-FIX anchor points together with the load can be stress relieved by heat treating (e.g. welded construction) once. Temperature: < 600°C (one hour maximum). After stress-relieving heat treatment (< 600°C), however, the spring force is no longer usable.

- RUD-Lashing points LRBS-FIX must not be used with aggressive chemicals such as acids, alkaline solutions and their vapours.
- Please mark mounting position of lashing point with a coloured contrast paint for better visibility.
- LRBS-FIX includes a protected positioned clamping spring, inside the weld-on block. The spring holds the weld-on blocks together with the ring and creates at the same time a radial clamping function.
- RUD-lashing points LRBS-FIX are clearly marked at the suspension ring with the permissible Lashing capacity „LC“ in daN.
- LRBS-FIX will be delivered as a complete assembled unit.

3.2 Hints for the assembly

Basically essential:

- The material construction to which the lashing point will be attached should be of adequate strength to withstand forces during lashing without deformation. The weld-on material must be suitable for welding and the contact areas must be free from dirt, oil, colour, ect. The material of the forged welding block is: S355J2+N (1.0577+N (St52-3))
- The position of the lashing points must be carried out in regard to the lashing means in such a way that unintended movement like turning or flipping of the load will be avoided.
- Determine number and position of the lashing points at vehicles according to EN 12640 resp. DIN 75410 (for RoRo-transportation acc. to EN 29367), unless the vehicles are not determined due to their design and construction for transporting specific goods with special requirements in regard of load securing.
- Position lashing points as much as possible at the outside width of the loading platform.



HINT

The lashing points must not protrude in rest position over the loading platform level.

- Determine the necessary lashing capacity of each lashing point acc. to EN 12195-1 "Load securing devices on road vehicles" - "Calculation of lashing forces" and VDI 2700 "Load securing of road vehicles."
- Check finally the correct assembly (see chapter 4, Inspection criteria).

3.3 Hints for the welding

The welding should only be carried out according to DIN EN ISO 9606-1 or AWS Standards by an authorized and certified welder.

Verification of the used weld-on material must be checked with the supplier of the welding electrodes.



HINT

- *Never weld at the quenched and tempered ring!*
- *Weld all seams at the same temperature.*

1. Check before initial appending of the LRBS-Fix, the position of the weld-on blocks to each other, that means the base area must be at the same level.
2. Append weld-on blocks.
3. Check function of the ring. The ring must be able to pivot 180°. If necessary please correct.
4. Remove any welding mistakes and dirt at the root weld before applying the cover weld seams.
5. Weld blocks on (HY-weld circumferential). Choose type of weld seam and size according to picture 2 and chart 2.
6. Please check by a competent person after welding the ongoing usage of the weld-on lashing point (see chapter 4, Inspection criteria)



HINT

By the position of the weld-seam (HY-weld circumferential) the following requirements will be observed: DIN 18800 steel constructions requires: at outdoor buildings or when strong corrosion must be expected weld seams must be carried out as continuous fillet weld seams.

3.4 User instructions


- Check frequently and before each initial operation the whole lashing point in regard of linger ability as a lashing mean, regarding corrosion, wear, deformation etc. (see chapter 4, Inspection criteria).




ATTENTION

Wrong positioned or damaged weld-on lashing points as well as improper use can lead to injuries of persons and damage at property, when load falls down. Please check all lashing points carefully before every usage.

- Please check carefully the wear indicator markings of the weld-on lashing point (see picture 1):

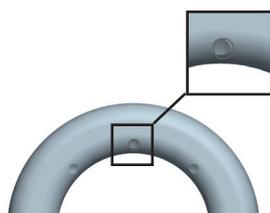

Usage permitted:
no wear marks visible

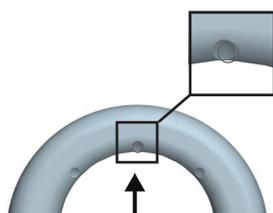

Use prohibited:
Replacement criteria reached. Material all the way down to the wear lenses has gone.

Pic 1: Wear indicators

- Please note that the lashing mean must be free moveable in the LRBS-FIX. When lashing means (f.e. lashing chain) are hinged or unhinged, no pinching, shearing or joint spots must occur during the handling.
- Avoid damage of lashing means resulting from sharp edges.
- Lashing points must not be used for lifting loads.


3.5 Hints for regular inspection

In time periods complying to the need or usage, a technical expert must control at least once a year the appropriateness of the lashing point. This inspection must also be done after each event of damage or special incident.

4 Inspection criteria

Observe and control the following points before each initial operation, in regular time intervals, after the assembly and after special incidents.

- Completeness of the lashing point
- Complete and readable marking of Lashing Capacity as well as manufacturer sign
- Deformation at load bearing components like base body and Ring.
- Mechanical damage, like strong notches, especially in areas where tensile stress occurs.
- Reduction of cross-section due to wear >10 %
- Evidence of corrosion (pitting)
- Evidence of cracks
- Cracks or other damages at weld seam

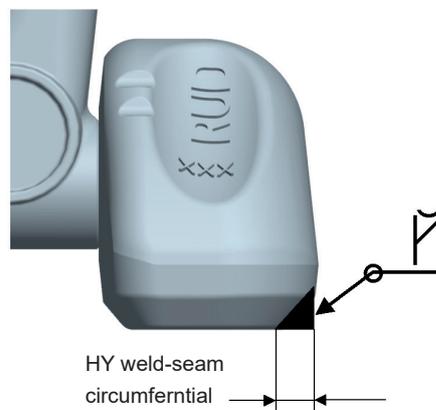

Pic. 2: HY-weld seam

Europe, USA, Asia, Australia, Africa

Baustähle, niedrig legierte Stähle EN 10025,
Mild steels, low alloyed steel EN 10025

| | |
|---|--|
| MIG / MAG (135) Gas shielded wire welding (135) | DIN EN ISO 14341: G4Si1 (G3Si1) Z.B. PEGO G4Si1 |
| E-Hand Gleichstrom (111, =) Stick Electrode direct current | DIN EN ISO 2560-A: E 42 6 B 3 2 H10 DIN EN ISO 2560-A: E 38 2 B 1 2 H10 z.B. PEGO B Spezial*/ PEGO BR Spezial* |
| E-Hand (Wechselstrom 111, ~) Stick Electrode alternating current | DIN EN ISO 2560-A: E 38 2 RB 1 2 DIN EN ISO 2560-A: E 42 0 RC 1 1 z.B. PEGO RC 3 / PEGO RR B 7 Alternativ: DIN EN ISO 3581: E 23 12 2 L R 3 2 z.B. PEGO 309 MoL |
| WIG (141) TIG Tungsten arc welding | DIN EN ISO 636-A: W 3 Si 1 (W2 Si 1) DIN EN ISO 636-A: W 2 Ni 2 z.B. PEGO WSG 2 / PEGO WSG2Ni2 |




HINT

Please note the corresponding user hint in regard of the welding filler materials and the drying requirements*.


Chart 1: Welding procedure + Welding filler metals

| Type | Size | Length | Volume |
|----------------|------|------------|------------------------------|
| LRBS-FIX 8000 | HY 3 | 2 x 154 mm | approx. 1.4 cm ³ |
| LRBS-FIX 13400 | HY 5 | 2 x 214 mm | approx. 5.35 cm ³ |
| LRBS-FIX 20000 | HY 6 | 2 x 252 mm | approx. 9 cm ³ |
| LRBS-FIX 32000 | HY 9 | 2 x 341 mm | approx. 27 cm ³ |


Chart 2: Weld seam (weld-on block)

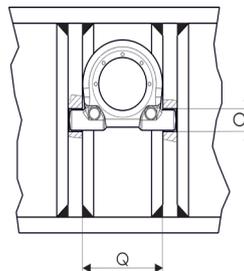

Pic 3: Lashing Ring is integrated in the design

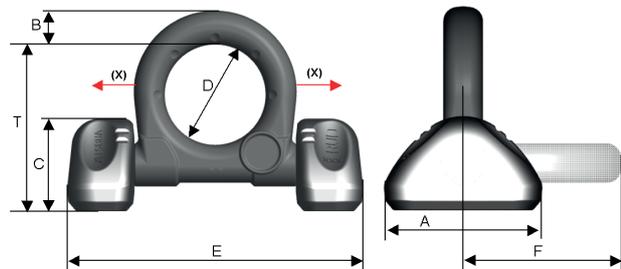

Pic 4: Dimensioning LRBS-FIX complete

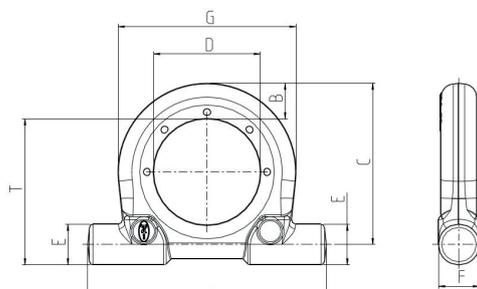

Pic 5: Dimensioning Lashing Ring

| Type LRBS-FIX compl. | LC [daN] | A [mm] | B [mm] | C [mm] | D [mm] | E [mm] | F [mm] | T [mm] | weight [kg/pc.] | Ref. no |
|----------------------|----------|--------|--------|--------|--------|--------|--------|--------|-----------------|---------|
| LRBS-FIX 8000 | 8000 | 60 | 14 | 39 | 48 | 132 | 69 | 74 | 0.93 | 7999303 |
| LRBS-FIX 13400 | 13400 | 88 | 20 | 50 | 60 | 167 | 91 | 97 | 2.2 | 7999304 |
| LRBS-FIX 20000 | 20000 | 100 | 22 | 60 | 65 | 191 | 100 | 108 | 3.7 | 7999305 |
| LRBS-FIX 32000 | 32000 | 130 | 30 | 72 | 90 | 267 | 134 | 140 | 8.0 | 7999306 |

Chart 3: Dimensioning LRBS-FIX complete

Subject to technical alterations

| Type Lashing Ring | LC [daN] | A [mm] | B [mm] | C [mm] | D [mm] | E [mm] | F [mm] | G [mm] | T [mm] | O [mm] | Q [mm] | weight [kg/pc.] | Ref. no |
|--------------------|----------|--------|--------|--------|--------|--------|--------|--------|--------|--------------------|-------------------|-----------------|---------|
| Lashing Ring 8000 | 8000 | 107 | 14 | 69 | 48 | 17 | 18 | 76 | 63.5 | 19 ^{+0.5} | 77 ⁺¹ | 0.38 | 7902251 |
| Lashing Ring 13400 | 13400 | 134 | 20 | 91 | 60 | 23 | 23 | 100 | 82.5 | 25 ^{+0.5} | 101 ⁺¹ | 0.96 | 7902252 |
| Lashing Ring 20000 | 20000 | 152 | 22 | 100 | 65 | 28 | 29 | 105 | 92 | 30 ^{+0.5} | 106 ⁺¹ | 1.46 | 7902331 |

Chart 4: Dimensioning LRBS-FIX Lashing Ring

Subject to technical alterations